



Forum: LASER

Topic: LEXMARK X203N ERRO 935.10

Subject: Re: LEXMARK X203N ERRO 935.10

Enviado por: AlvaroLoc

Enviado em: 07/08/2016 20:59:03

Vc abriu a unidade laser?

Manual:

Unplug the MFP.

Disconnect the printhead cables from J13 and J12 on the controller card.

Turn the MFP on.

On the controller card, verify +24 V dc on pin 5 at J13 and +5 V dc on pin 7 at J12.

Verify grounds on pin 4 at J13 and on pins 2, 6, and 8 at J12.

- If voltages or grounds are incorrect, check the controller card. See "Controller card service check" on page 2-25 for more information.
- If voltages are correct, replace the printhead (cables are included).